

06-001/17 - LEATHER STEERING WHEEL SURFACE WEAR / PEEL

SI106937

TSB NUMBER: 06-001/17

TSB ISSUE DATE

06/02/2017

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below: The changes are noted in Red.

Previous TSBs:	Date(s) Issued:
06-001/17	04/25/2017

APPLICABLE MODEL(S)/VINS

2014-2016 Mazda3 Japan built vehicles with VINs lower than JM1 BM ***** 355940 (produced before June 23, 2016)

2014-2016 Mazda6 vehicles with VINs lower than JM1 GJ ***** 488592 (produced before June 30, 2016)

2016-2017 CX-3 vehicles with VINs lower than JM1 DK ***** 172170 (produced before March 08, 2017)

2016-2017 CX-5 vehicles with VINs lower than JM3 KE ***** 921726 (produced before December 21, 2016)

DESCRIPTION

Some vehicles may exhibit wear/peel-off of the leather steering wheel surface causing a poor appearance. This concern may be caused by an insufficient wear resistance of the steering wheel surface.

Mazda6 is shown as an example




Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

Note: Some vehicles may have steering wheel stains caused by chemicals such as hand lotions.

1. Use a clean towel dampened in leather/vinyl cleaner or mild soap to clean the steering wheel.

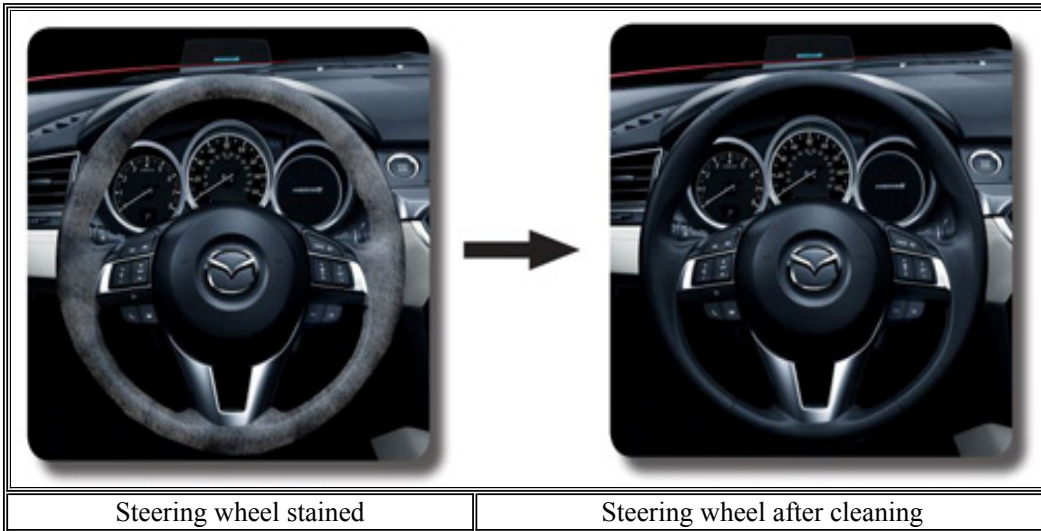


2. Is the steering wheel wear/peel concern present after cleaning the steering wheel?

- Yes - Go to Step 3.
- No - This service bulletin does not apply.

3. Replace the steering wheel (A). Refer to MGSS online Workshop Manual:

- Mazda3 - [STEERING WHEEL AND COLUMN REMOVAL/INSTALLATION](#).
- Mazda6 - [STEERING WHEEL AND COLUMN REMOVAL/INSTALLATION](#).
- CX-3 - [STEERING WHEEL AND COLUMN REMOVAL/INSTALLATION](#).
- CX5 - [STEERING WHEEL AND COLUMN REMOVAL/INSTALLATION](#).

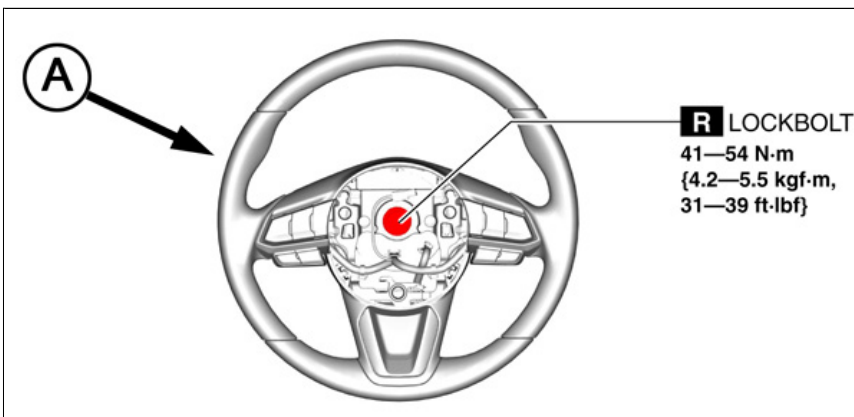

4. Verify repair.

PARTS INFORMATION

Parts Number	Description	Qty.	Notes
KD46-32-982C02 or KDY6-32-982	STEERING WHEEL	1	CX-3 (Leather, black stitch) CX-5 (Leather, black stitch)
KA0G-32-982 02	STEERING WHEEL	1	CX-5 (Smooth leather, black stitch)
BHP2-32-982B02 or BHY2-32-982	STEERING WHEEL	1	Mazda3 (Leather, black stitch)
GHR1-32-982B or GHY1-32-982	STEERING WHEEL	1	Mazda6
9YA0-11-003A	BOLT	1	CX-3, CX-5
9YA0-11-007	BOLT	1	Mazda3, Mazda6

Note:

- Use GEPC to look up correct part number by VIN.
- If steering wheel part with the "Y" in the 3rd digit is in your dealer's inventory, you may use it for this repair.
- Both steering wheel part numbers with or without the "Y" in the 3rd digit provide the same repair performance.

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda’s New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	45
Damage Code	9C
Part Number Main Cause	GHR1-32-982B or GHY1-32-982, Steering Wheel (Mazda6) BHP2-32-982B02 or BHY2-32-982, Steering Wheel (Mazda3) KD46-32-982C02 or KDY6-32-982, Steering Wheel (CX-3, CX-5) KA0G-32-982 02, Steering Wheel (CX-5)
Quantity	1
Operation Number / Labor Hours:	XXMA6XRX / 0.4 Hrs.