



NUMBER: 08-150-18 REV. A

GROUP: 08 - Electrical

DATE: December 19, 2018

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

THIS BULLETIN SUPERSEDES SERVICE BULLETIN 08-150-18, DATED DECEMBER 11, 2018, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS**** AND INCLUDE ADDITIONAL MODEL YEAR AND BUILD DATE.**

SUBJECT:

Flash: Power Lift Gate Module (PLGM) System Updates

OVERVIEW:

This bulletin involves reprogramming the PLGM with the latest available software.

MODELS:

2017 - **2019**	(WK)	Jeep Grand Cherokee
2017 - **2019**	(WD)	Dodge Durango

NOTE: This bulletin applies to vehicles within the following markets/countries: NAFTA.

NOTE: This bulletin applies to vehicles built on or before ****December 12, 2018 (MDH 1212XX)**** equipped with a Power Liftgate (Sales Code JRC).

SYMPTOM/CONDITION:

The customer may also experience one or more of the following:

- The power liftgate can still be opened without the key fob within the first 90 seconds following the vehicle being locked.
- Intermittently the power liftgate may not open.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in Service Library/TechCONNECT, verify all related systems are functioning as designed. If Diagnostic Trouble Codes (DTCs) or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition listed above, perform the Repair Procedure.

REPAIR PROCEDURE:

NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. Reprogram the PLGM with the latest software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application's "HELP" tab.
2. Using wiTECH, perform a liftgate calibration routine. This routine can be found in Misc Functions.
3. Clear any DTCs that may have been set in any module due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allows them to be cleared.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
18-19-31-9A	Module, Power Liftgate Control - Reprogram (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.

NOTE: The expected completion time for the flash download portion of this procedure is approximately 2 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.

FAILURE CODE:

The dealer must use failure code CC with this Service Bulletin.

- If the customer's concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used.
- When utilizing this failure code, the 3C's (customer's concern, cause and correction) must be provided for processing Service Bulletin flash/reprogramming conditions.

CC	Customer Concern
----	------------------